



RECALL DATE: 26-09-2024

KIA Telluride (ON)

Brand of Commodity	Year of Production*	#Number of Affected Commodities
Telluride (ON)	Jan 2019 - May 2024	506

^{*}Not all vehicles in this production period, are affected.

#Subject to revision, based on the information received from the manufacturer, from time to time.

Recall consequence

On some Telluride (ON) of 2019 - 2024 MY produced within specific production date range provided in TSB. If there is an external impact with excessive force to the front power seat side cover and / or seat slide knob, the power seat switch back cover can dislodge resulting in internal misalignment of the seat motor control switch. A misaligned seat motor control switch with a stuck seat slide knob can lead to continuous operation of the motor. The continuous operation of the seat motor can result in overheating of the motor, thereby increasing the risk of fire while driving or while parked. The estimated defect ratio is 1%. However, Kia is conducting this recall as preventive measure to avoid the risk.

Recall Action

Verify affected vehicles as per the VIN list, inspect front seat motor control switch and repair or replace seat motor control switch and seat slide knob. All affected vehicles will be inspected and repaired at no expense to the vehicle owner.

To check the serial Numbers of the affected commodities, please visit the website for Recalls & Warnings: http://recall.pacp.gov.om





