

RECALL DATE: 30-09-2024

KIA Stinger (CK)

| Brand of Commodity | Year of Production* | #Number of Affected Commodities |
|--------------------|---------------------|------------------------------------|
| Stinger (CK) | Nov 2016 - Mar 2023 | 15 |
| | | |

^{*}Not all vehicles in this production period, are affected.

#Subject to revision, based on the information received from the manufacturer, from time to time.

Recall consequence

On some Stinger (CK) of 2016 - 2023 MY produced within specific production date range provided in TSB. Overtime, the left - hand (LH) turbo charger oil feed pipe and hose assembly may deteriorate due to exposure to radiant heat from the exhaust manifold. This lead to oil leaks which is in the presence of hot exhaust components, increase the risk of an engine compartment fire while driving. The affected vehicle may experience oil leak, burning smell, white smoke from engine compartment and / or illumination of the engine oil pressure warning light. The estimated defect ratio is 1%. However, Kia is conducting this recall as preventive measure to avoid the risk

Recall Action

Verify affected vehicles as per the VINI list, inspect the oil leakage and replace turbo charger oil feed pipe as per KMC recommendation. All affected vehicles will be inspected and repaired at no expense to the vehicle owner.

To check the serial Numbers of the affected commodities, please visit the website for Recalls & Warnings: http://recall.pacp.gov.om





