



Recall

FORD F150

RECALL DATE: 20-10-2024

Brand of Commodity	Year of Production*	#Number of Affected Commodities
F150	June 17, 2013, through August 25, 2014 July 26, 2013, through December 23, 2014	115

*Not all vehicles in this production period, are affected.

#Subject to revision, based on the information received from the manufacturer, from time to time.

Recall consequence

In some of the affected vehicles, an intermittent Output Shaft Speed Sensor (OSS) failure may result in an unintended downshift into first gear. Depending on vehicle speed at the time of the downshift, an abrupt wheel speed reduction may occur, which could cause the rear tires to slide or lock up until the vehicle speed slows. This condition could result in a loss of vehicle control, increasing the risk of a crash.

Recall Action

Check for DTCs P0720, P0722, P0731 and/or P1500 stored in PCM if no DTCs present, check for available powertrain control module (PCM) software update and reprogram the PCM using IDS Release 130.05 or higher.
If DTCs present, replace the molded leadframe.

To check the serial Numbers of the affected commodities, please visit the website for Recalls & Warnings: <http://recall.pacp.gov>



Contact details: Toll free - 80073111
Working days: Sunday - Thursday
Working Time: 8.00 - 17.00 hrs.


هيئة حماية المستهلك
Consumer Protection Authority
www.pacp.gov.om



خط المستهلك
Consumer line
80079009
80077997